



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200
Fax 613 632-5246

D205-634-041
Job Sheet 194392



Part No: D205-634-041

Job Qty: 1 pcs

Part Name: Replacement Skidtube with Standard Wearplates Fits LH or RH



Part Weight: 0 lbs

Status: New

Priority: Medium

Job Created: 5/1/19

Job Tracking No:

Due Date: 5/30/19

Created By: Marie Lajeunesse

Type: Stock

Description:

Note: DWG D2580 REV H SHEETS 1,2,3,8 IPP Rev:N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30 KJ IPP Rev P 10.02.19 per PAR09-043 EC verified by:DD IPP Rev. O 06.02.28 Added paperwork EC IPP Rev:P 07-07-09 SS Wearplates & Gaskets JLM IPP Rev:Q 10.12.01 as per chg003 DD ver:EC IPP REV:R 12.01.23 AS PER ECN11-684 VERF:EC IPP REV:S 17.12.08 REMOVE GASKET AS PER INTUITIVE INFO DD VERF:JFS

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup Hrs	Run Hrs	Workcenter / Supplier	Lead Time	
110	Skidtubes - Bend - 1	1 pcs		5/30/19	0.00	0.65	Skidtubes - Bend		MLL
120	Skidtubes - 2 - B4B	1 pcs		5/30/19	0.00	2.89	Skidtubes - 1 - B4B		
							Skidtubes - 2 - B4B		
							Skidtubes - 3 - B4B		
							Skidtubes - 4 - B4B		TF
							Skidtubes - 5 - B4B		
							Skidtubes - 6 - B4B		
							Skidtubes - 7 - B4B		
130	QC 5	1 pcs		5/30/19	0.00	0.00	QC 5 - 10		
							QC 5 - 12		
							QC 5 - 17		
							QC 5 - 18		BE
							QC 5 - 19		
							QC 5 - 22		
							QC 5 - 24		
							QC 5 - 3		
							QC 5 - 43		
							QC 5 - 49		
							QC 5 - 51		
							QC 5 - 58		
							QC 5 - 68		
							QC 5 - 9		
							QC 5 - 50		
							QC 5 - 30		
							QC 5 - 40		
140	Skidtubes - 3 - B4B	1 pcs		5/30/19	0.00	2.89	Skidtubes - 1 - B4B		
							Skidtubes - 2 - B4B		



Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
CANADA
TEL : 1 613 632-5200
Email: sales@dartaero.com
www.dartaerospace.com

Container No: S181308



Part: D205-634-041

Job No: 194392

Serial No/Batch: S181308

Revision: H

Inspector:

Exp Date:

Instructions: TC STC SH96-88 Issue 3 FAA STC SR005631

Plex 5/1/19 11:46 AM Dart.lajeunesse.marie

					Skidtubes - 3 - B4B	
					Skidtubes - 4 - B4B	TF
					Skidtubes - 5 - B4B	BE
					Skidtubes - 6 - B4B	
					Skidtubes - 7 - B4B	
					QC 10 - 10	
150 QC 10	1 pcs	5/30/19	0.00 0.00		QC 10 - 18	
					QC 10 - 24	DAS
					QC 10 - 43	24
					QC 10 - 50	9-89
					QC 10 - 58	
					QC 10 - 9	
					QC 5 - 10	
					QC 5 - 12	
					QC 5 - 17	
					QC 5 - 18	
					QC 5 - 19	
					QC 5 - 22	
160 QC 5	1 pcs	5/30/19	0.00 0.00		QC 5 - 24	DAS
					QC 5 - 3	24
					QC 5 - 43	9-89
					QC 5 - 49	
					QC 5 - 51	
					QC 5 - 58	
					QC 5 - 68	
					QC 5 - 9	
					QC 5 - 50	
					QC 5 - 30	
					QC 5 - 40	
					QC 5 - 40	
170 Handfinish - 1-1 Chemical-B4B	1 pcs	5/30/19	0.00 1.31		Handfinish - 1 - 1 - B4B	
					Handfinish - 1 - 2 - B4B	
					Handfinish - 1 - 3 - B4B	
					Handfinish - 1 - 4 - B4B	
					Handfinish - 1 - 5 - B4B	302
					Handfinish - 1 - 6 - B4B	
					Handfinish - 1 - 7 - B4B	
					Handfinish - 1 - 8 - B4B	
					Handfinish - 1 - 9 - B4B	
					Handfinish - 1 - 10 - B4B	
					Handfinish - 1 - 11 - B4B	
					Handfinish - 1 - 12 - B4B	
					Handfinish - 1 - 13 - B4B	
					Handfinish - 1 - 14 - B4B	
					Handfinish - 1 - 15 - B4B	
					Handfinish - 1 - 16 - B4B	
					Handfinish - 1 - 17 - B4B	
					Handfinish - 1 - 18 - B4B	
					Handfinish - 1 - 19 - B4B	
					Handfinish - 1 - 20 - B4B	
					Handfinish - 1 - 21 -	

**DAS
15
9-89**

220 Packaging 3-1 - Stock - B4B	1 pcs	5/30/19	0.00 0.00	QC 5 - 9	
				QC 5 - 50	
				QC 5 - 30	DAS 40 9-89
				QC 5 - 40	JUN 07 2019
				Packaging 3 - 1 - B4B	
				Packaging 3 - 2 - B4B	
				Packaging 3 - 3 - B4B	
				Packaging 3 - 4 - B4B	
				Packaging 3 - 5 - B4B	
				Packaging 3 - 6 - B4B	
				Packaging 3 - 7 - B4B	DAS 58 9-89
				Packaging 3 - 8 - B4B	JUN 10 2019
				Packaging 3 - 9 - B4B	
				Packaging 3 - 10 - B4B	
				Packaging 3 - 11 - B4B	
				Packaging 3 - 12 - B4B	
				Packaging 3 - 13 - B4B	
				Packaging 3 - 14 - B4B	
				Packaging 3 - 15 - B4B	
				Packaging 3 - 16 - B4B	
				Packaging 3 - 17 - B4B	
				Packaging 3 - 18 - B4B	
				Packaging 3 - 19 - B4B	
				Packaging 3 - 20 - B4B	
				Packaging 3 - 21 - B4B	
				Packaging 3 - 22 - B4B	
				Packaging 3 - 23 - B4B	
				Packaging 3 - 24 - B4B	
				Packaging 3 - 25 - B4B	
				Packaging 3 - 26 - B4B	
				Packaging 3 - 27 - B4B	
				Packaging 3 - 28 - B4B	
				Packaging 3 - 29 - B4B	
				Packaging 3 - 30 - B4B	
				Packaging 3 - 31 - B4B	
				Packaging 3 - 32 - B4B	
				Packaging 3 - 33 - B4B	
				Packaging 3 - 34 - B4B	
				Packaging 3 - 35 - B4B	
				Packaging 3 - 36 - B4B	
225 DC - 1 - B4B	1 pcs	5/30/19	0.00 0.00	DC - 1 - B4B	DAS 21 9-89
				DC - 2 - B4B	JUN 10 2019
230 QC 21 - FG	1 pcs	5/30/19	0.00 0.00	QC 21 - FG - 21	
				QC 21 - FG - 70	DAS 21 9-89
				QC 21 - FG - 53	JUN 10 2019

Part Op 110 - Skidtubes - 1-Bend as per program D2580.C on CNC Bender and Folio 16 2-Cut tubes as per Dwg. D2580 3- scribe
Descriptions: batch# in aft end of tube

120 - Skidtubes - 1- Deburr ends and remove bending marks 2- Prepare tube for welding as per QSI 004

130 - QC5- Inspect part completeness to step on W/O

140 - Skidtubes 1-Weld step D2576 as per Dwg. D2580 and QSI 004 2-Grind welds on step as per Dwg D2580 3- Insert D4202-1 spacer, swage as per QSI002 and trim/ grind flush per QSI002 and dwg. Hold x-bolt with DT9701 Use tube expander 1/2 x17G to start expansion and finish with 1/2 x 18G to achieve dwg dimension. 4-Drill holes for wearplates using DT 8217 & DT8937, 7.40" from most fwd saddle holes (ref only) Open holes to 19/64", adjust stopper not to hit web. Deburr 5-Drill pilot holes for aft cap using DT 8215 Open holes to 0.208". Deburr 6-Drill pilot holes for Tow ring using DT8091, open to .640" and Deburr

150 - QC10- Inspect visual per QSI004- ground welds

160 - QC5- Inspect part completeness to step on W/O

170 - Chemical Conversion Coat per QSI005 4.1 - Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch and leave fwd cap out of solution.

180 - White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum START TIME: 11:20 OVEN TEMPERATURE: 320°
FINISH TIME: 11:50

190 - QC3- Inspect Part Finish

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

200 - Assemble as per dwg - 1-Install inserts & wearplates as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates A/R Sikaflex-291 S174342 Sikaflex expire date: 19/12 2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580 3-Inspect for foreign object per QSI 024 4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive A/R Sikaflex-291 S174342 Sikaflex expire date: 19/12 5-Wing Walk as per Dwg D2580 and QSI 005 4.4 Batch: S163430

210 - QC5- Inspect part completeness to step on W/O - Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

220 - Identify and pack for shipping as per PPPD205-634-041 Location: _____ PPP Rev: _____

225 - Document Control - Photocopy D205-634 bluefile & type labels per PPP D205-634-041 CHG006

230 - QC21- Final Inspection - Work Order Release

Job BOM

Part / Item	Component Name	Quantity	Operation	Container
D2580-1	205 Bent Tube	1 pcs (1 ea)	110-Skidtubes - Bend - 1	<u>S178232</u>
D2576-3	Step (Machining Detail)	1 pcs (1 ea)	140-Skidtubes - 3 - B4B	<u>5089827</u>
D4202-1	Spacer	20 pcs (20 ea)	140-Skidtubes - 3 - B4B	<u>S153691</u>
ALS7-1032-130	Rivnut	50 Ea (50 ea)	200-Handfinish - 4-1-Assembly-B4B	<u>S159769.</u>
AN3-5A	Bolt	2 Ea (2 ea)	200-Handfinish - 4-1-Assembly-B4B	<u>5095480</u>
AN3C4A	Bolt	50 Ea (50 ea)	200-Handfinish - 4-1-Assembly-B4B	<u>S143675</u>
D2594-1	Plug	16 pcs (16 ea)	200-Handfinish - 4-1-Assembly-B4B	<u>S173699.</u>
D2594-3	O-Ring	16 pcs (16 ea)	200-Handfinish - 4-1-Assembly-B4B	<u>S173297.</u>
D2855	Cap	1 pcs (1 ea)	200-Handfinish - 4-1-Assembly-B4B	<u>S126188</u>
D3564-11	Wearplate Aft	1 pcs (1 ea)	200-Handfinish - 4-1-Assembly-B4B	<u>S177009.</u>
D3564-13	Wearpad Fwd	1 pcs (1 ea)	200-Handfinish - 4-1-Assembly-B4B	<u>*S182449.</u>
D3564-5	Wearplate Center	1 pcs (1 ea)	200-Handfinish - 4-1-Assembly-B4B	<u>*S185270</u>
D3564-9	Wearplate Fwd	1 pcs (1 ea)	200-Handfinish - 4-1-Assembly-B4B	<u>*S186896.</u>
NAS1149C0332R	Washer	50 Ea (50 ea)	200-Handfinish - 4-1-Assembly-B4B	<u>S158078.</u>
NAS1149D0332J	Washer	2 Ea (2 ea)	200-Handfinish - 4-1-Assembly-B4B	<u>S178378.</u>

M.U. 010051

Job Allocations

Operation	Component Part	Required	Inventory	Allocated
110-Skidtubes - Bend - 1	D2580-1	1	0	0
140-Skidtubes - 3 - B4B	D2576-3	1	53	0
	D4202-1	20	578	0
200-Handfinish - 4-1-Assembly-B4B	ALS7-1032-130	50	1,542	0
	AN3-5A	2	284	0
	AN3C4A	50	1,456	0
	D2594-1	16	234	0
	D2594-3	16	539	0
	D2855	1	61	0
	D3564-11	1	15	0
	D3564-13	1	8	0
	D3564-5	1	9	0
	D3564-9	1	9	0
	NAS1149C0332R	50	5,406	0
	NAS1149D0332J	2	2,586	0

Part Specifications

Specifications could not be found.

Plex 5/1/19 11:46 AM Dart.lajeunesse.marie

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					



2017 JUL 05 *af*

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA DRAWING NO. D2580 TITLE 205 SKIDTUBE ASSEMBLY SCALE NTS COPYRIGHT © 1986 BY DART AEROSPACE LTD THIS DOCUMENT IS THE PROPERTY OF DART AEROSPACE LTD AND IS LOANED TO YOU UNDER THE CONDITION THAT IT NOT BE USED FOR ANY PURPOSES OR COPIES OR REPRODUCED IN ANY MANNER WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE LTD	REV. H
DRAWN	SAD		SHEET 2 OF 6
CHECKED	<i>[Signature]</i>		
MFG. APPR.	<i>[Signature]</i>		
APPROVED	<i>[Signature]</i>		
DE APPR.	<i>[Signature]</i>		
DATE	17.06.09		

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QS1042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

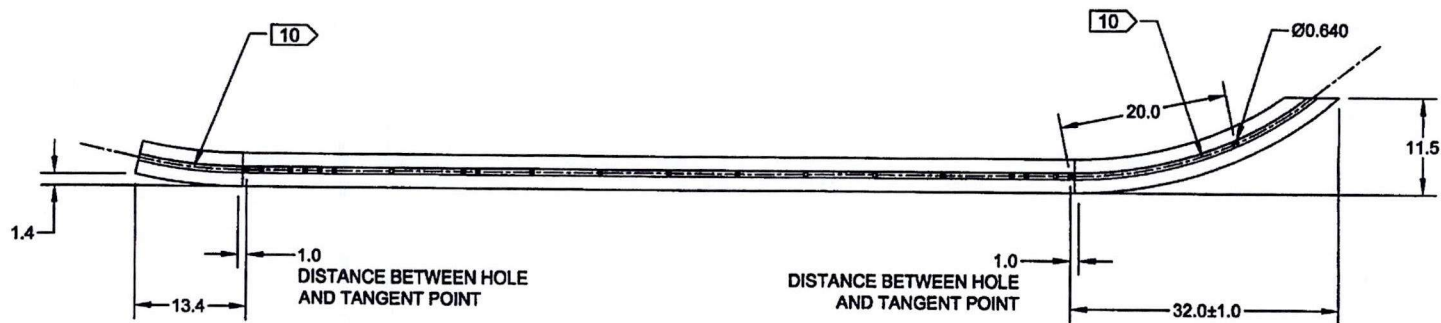

D2580-1 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2017 JUL 05 4²

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	SAD		
CHECKED	<i>MB</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>JS</i>	D2580	SHEET 3 OF 9
APPROVED	<i>JS</i>	TITLE	SCALE
DE APPR.	<i>JS</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1998 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____


Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QS1042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

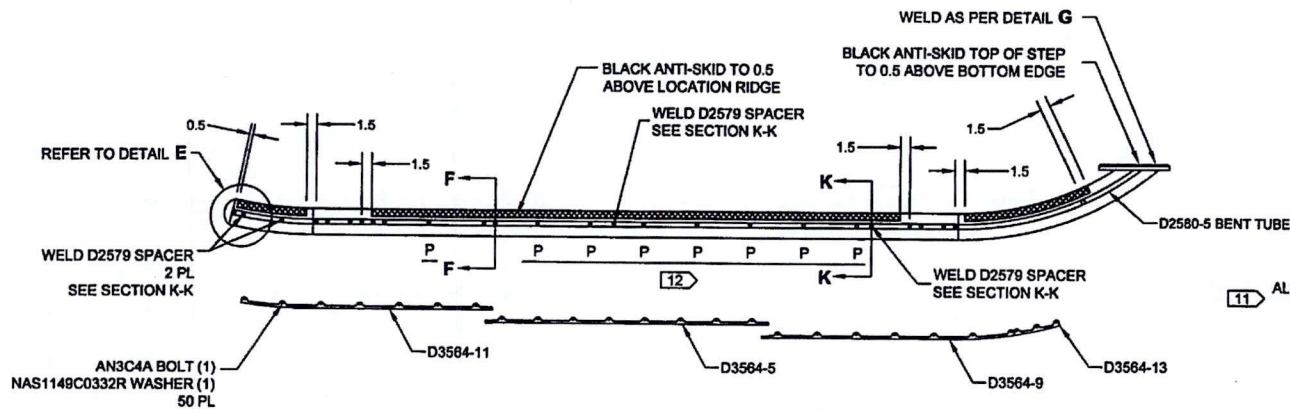


D2580-045 ASSEMBLY DETAIL

**SECTION K-K
SCALE 5X**

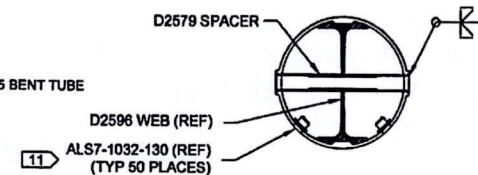


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (4 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. DO NOT C'BORE

**DETAIL E
SCALE 5X**

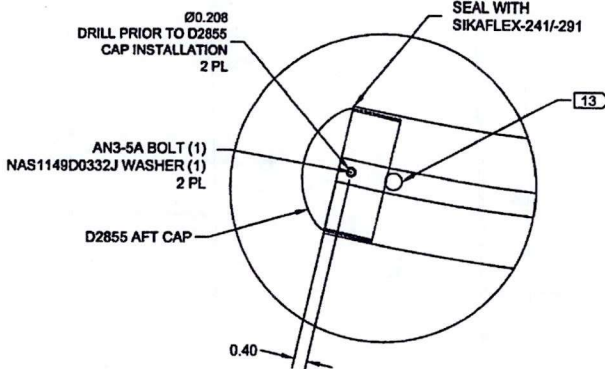


**SECTION F-F
SCALE 5X**

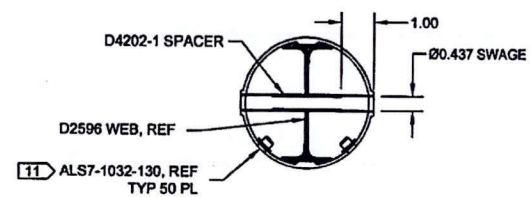

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. INSERT D4202-1 SPACER (20 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

**DETAIL G
SCALE 5X**

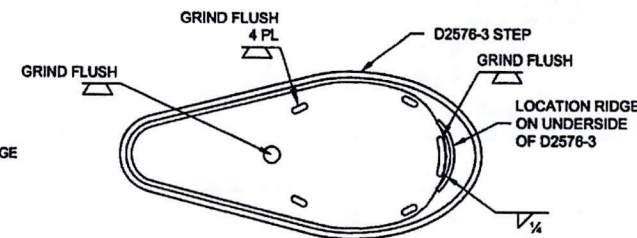

RELEASED
2017 JUL 05

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	SAD	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 4 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE, OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

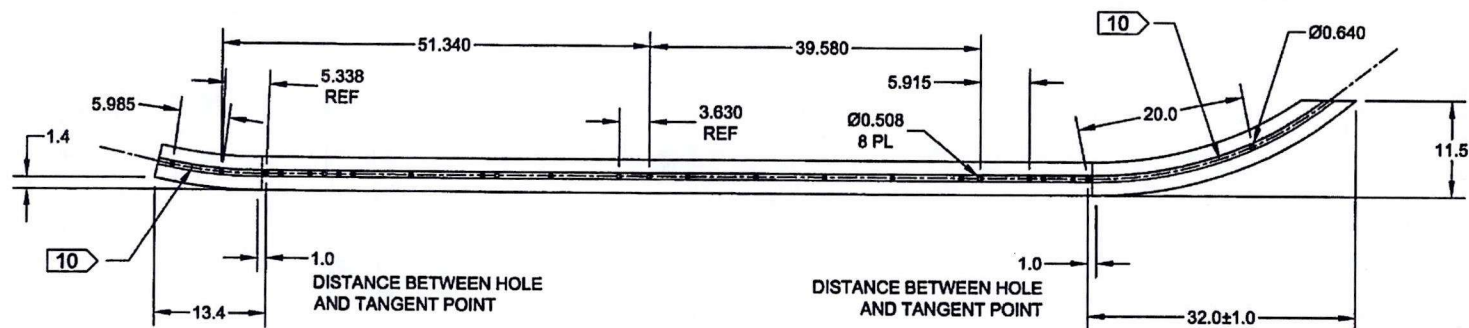

D2580-5 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED

2017 JUL 05

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	SAD		
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 5 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition			Completed By
					Lead hand / Supervisor
					QC / QA Coordinator
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

Entered: _____ Date: _____







WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QS1042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

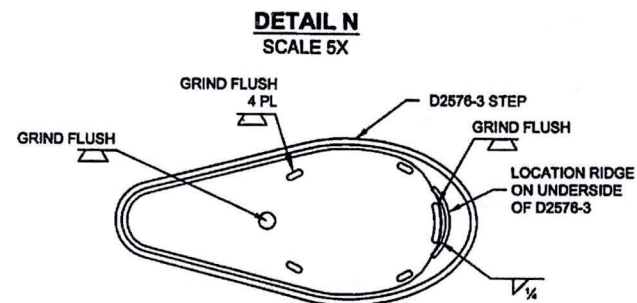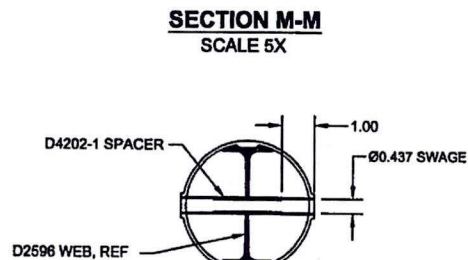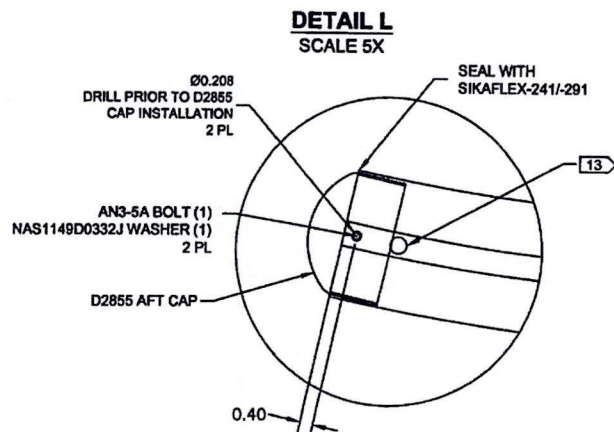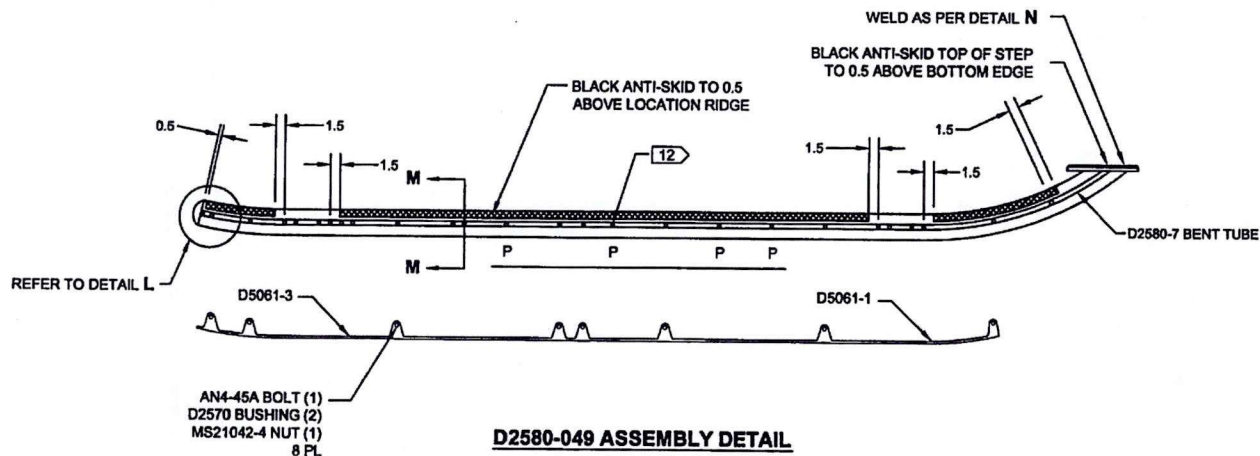

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. INSERT D4202-1 SPACER (24 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

RELEASED

2017 JUL 05

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	SAD	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 7 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1994 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐					
Date :	Sequence #:	QTY Affected :		MRB (QS1042)			
Description Work Order Deviation		Disposition			Completed By		
					Lead hand / Supervisor		
					QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread					
Other/Details:							

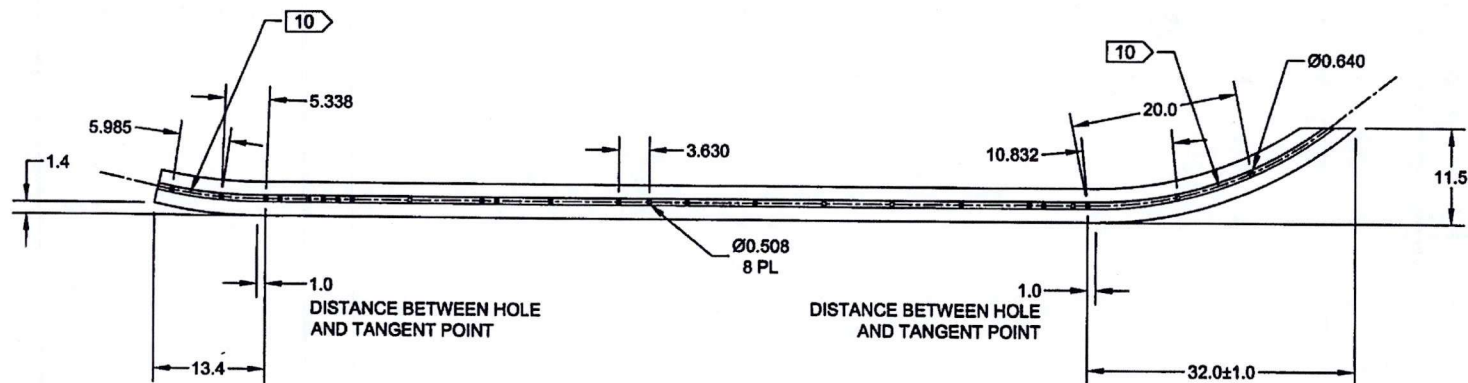

D2580-7 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2017 JUL 05 *q*

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	SAD		
CHECKED	<i>MS</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>MS</i>	D2580	SHEET 8 OF 9
APPROVED	<i>SH</i>	TITLE	SCALE
DE APPR.	<i>SH</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1998 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE


NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

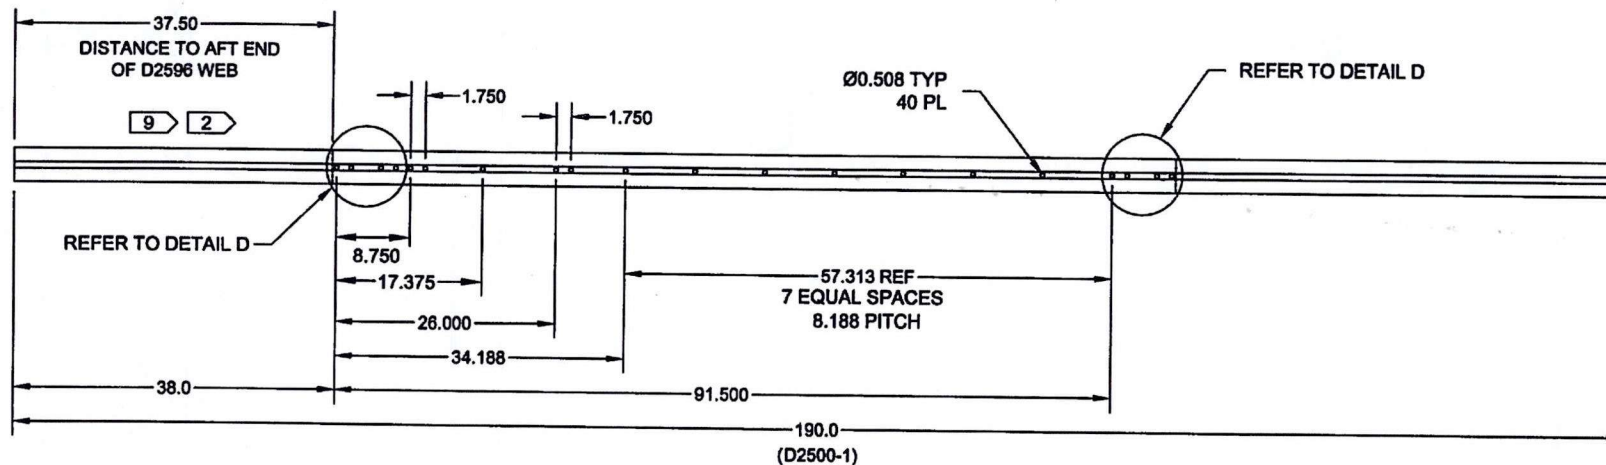

D2580-101 TUBE

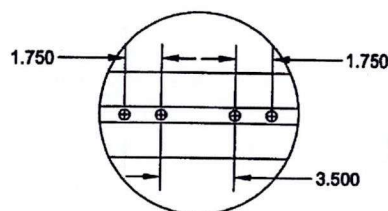

DETAIL D
SCALE 5X

RELEASED

2017 JUL 05

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	SAD	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 9 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1998 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

8

7

6

5

4

3

2

1

D

C

B

A

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand/ Supervisor	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread Other/Details:			

Change Record

PAGE 1 OF 1

Part Number: D205-634-041/-041DG/-041GY

Description: REPLACEMENT SKIDTUBE w/ STANDARD WEARPLATES, LH/RH

[illegible]